



# *Series II* **Bench Scales**



## Amendment Record

### *Series II*

**50777**

Manufactured by Fairbanks Scales Inc.  
821 Locust  
Kansas City, Missouri 64106

Issue 1	01/05	New Product
Issue 2	06/06	Add programmable division size
Revision 3	08/07	Updated Parts List and model specifications
Revision 4	10/08	Updated Parts List
Revision 5	04/10	Added recharger information
Revision 6	07/10	Added 150 lb capacity scale Measurement Canada exception
Revision 7	05/14	Updated Error Codes
Revision 8	09/16	Updated parts with Series II part numbers

#### **Disclaimer**

Every effort has been made to provide complete and accurate information in this manual. However, although this manual may include a specifically identified warranty notice for the product, Fairbanks Scales makes no representations or warranties with respect to the contents of this manual, and reserves the right to make changes to this manual without notice when and as improvements are made.

## *Table of Contents*

<b>Section 1:</b>	<b>General Information</b>	
	A. Introduction . . . . .	4
	B. Specifications . . . . .	4
<b>Section 2:</b>	<b>Installation</b>	
	A. General Service Policy . . . . .	6
	B. Overview . . . . .	6
	C. Unpacking . . . . .	6
	D. Instrument Location . . . . .	7
	E. Safety . . . . .	7
	F. Installation . . . . .	7
<b>Section 3:</b>	<b>Programming</b>	
	A. Function Keys . . . . .	8
	B. Program . . . . .	8
<b>Section 4:</b>	<b>Calibration</b>	
	A. Function Keys . . . . .	9
	B. Calibration Procedure . . . . .	10
<b>Section 5:</b>	<b>Operation</b>	
	A. Function Keys . . . . .	11
	B. Operation . . . . .	12
<b>Section 6:</b>	<b>Service and Maintenance</b>	
	A. Error Messages . . . . .	13
<b>Section 7:</b>	<b>Parts</b>	
	A. Replacement Parts List . . . . .	14

# Section 1: General Information

## A. Introduction

The Fairbanks Series II bench scales are high-accuracy, portable scales suited for both commercial and non-commercial applications. These scales are designed to be used in a variety of weighing applications including parts counting, inventory, material handling, and general manufacturing.

## B. Specifications

### 1. Instrument Specifications

<b>Model</b>	<b>Series II</b>	
<u>Product No.</u> <u>size</u>	<u>Capacities</u>	<u>Platform</u>
25825	60 lb x .02	12.5" x 16.5" (320 x 420 mm)
25826	100 lb x .05	12.5" x 16.5" (320 x 420 mm)
25827	150 lb x .05	12.5" x 16.5" (320 x 420 mm)
25828	200 lb x .1	12.5" x 16.5" (320 x 420 mm)
25829	250 lb x .1	12.5" x 16.5" (320 x 420 mm)
25830	300 lb x .1	12.5" x 16.5" (320 x 420 mm)
25831	200 lb x .1	15.75" x 18.9" (400 x 480 mm)
25832	250 lb x .1	15.75" x 18.9" (400 x 480 mm)
25833	300 lb x .1	15.75" x 18.9" (400 x 480 mm)
25834	400 lb x .2	15.75" x 18.9" (400 x 480 mm)
25835	500 lb x .2	15.75" x 18.9" (400 x 480 mm)
25836	600 lb x .2	15.75" x 18.9" (400 x 480 mm)
<b>Indicator Rating</b>	IP 54	
<b>Display</b>	LCD, height 1" (25 mm); 6 digit; backlit	
<b>Units</b>	Lbs, Kgs	
<b>Zero Range</b>	2 or 100%	
<b>Auto Zero Tracking</b>	None, 0.6d, 1.0d, and 2.0d	
<b>Counting</b>	Sample sizes of 10, 20, 50, 100, or 200	
<b>Platform Construction</b>	304 Stainless Steel	
<b>Base Construction</b>	Welded tubular and cast	
<b>Overload</b>	Safe = 150% Maximum = 300%	

**Creep** 0.02% (30min)  
**Bridge Resistance** 350 ohms  
nominal

## 2. Environmental

**Power Supply** AC/ DC adapter 110-120VAC - 9Vdc @ 500 mA,  
Built-in 6Vdc rechargeable lead-acid battery  
Up to 20hrs continuous use.  
Recharge time: Minimum of 12 hours for fully  
discharged battery

All Series II Bench Scales after serial number  
505159000150 will have an internal rechargeable  
battery.

**Operating Temperature** -14 to 104 F (-10 to 40 C) 85%RH

## 3. Approvals

NTEP CC#: **05-009**  
MC #: **AM-5618**

\***Note:** 150 lb capacity models are not Measurement Canada approved.

## Section 2: Installation

### A. General Service Policy

It is the customer/operator's responsibility to ensure the equipment provided by Fairbanks is operated within the parameters of the equipment's specifications and protected from accidental or malicious damage. Other than the procedures authorized in this manual, no service, repair, or adjustments may be performed by unauthorized/untrained service personnel. Any unauthorized repairs will void any verbal, implied, or written warranties.

### B. Overview

1. These instructions apply to the instrument and its specific installation procedures.
2. All electronic and mechanical calibrations and/or adjustments required to make this equipment perform to accuracy and operational specifications are considered to be part of the installation, and are included in the installation charge. Only those charges which are incurred as a result of the equipment's inability to be adjusted or calibrated to performance specifications may be considered warranty.
3. Absolutely no physical, electrical or program modifications are to be made to this equipment. Electrical connections other than those specified may not be performed, and physical alterations (holes, etc.) are not allowed.
4. Before the installation is considered complete, the equipment is to be programmed to meet or exceed any applicable weights and measures requirements, if applicable. The installing technician is responsible to make certain customer's personnel are fully trained and familiar with the capabilities and limitations of the equipment. Be prepared to recommend the arrangement of components which will provide the most efficient layout, utilizing the equipment to the best possible advantage. The warranty policy must be explained and reviewed with the customer.

### C. Unpacking

1. Check that all components are on hand, and agree with the equipment order.
2. Remove all components from their packing material, checking to make certain that all parts are accounted for and no parts are damaged. Advise the shipper immediately if damage has occurred. Order any parts necessary to replace those which have been damaged. **Keep the shipping container and packing material for warranty returns, if necessary.** Check the packing list.

3. The shipping carton should contain the following: Manual, Instrument, Platform, Pillar, and AC Adapter.

#### *D. Instrument Location*

1. The Instrument should be positioned away from direct sunlight.
2. Avoid areas which have extreme variations in room temperatures. Temperatures outside the instrument's specifications will effect the weighing accuracy of this product.
3. Work areas should be relatively free from drafts and vibrations.
4. This product is intended for indoor use.
5. Do not locate near magnetic material or equipment/instruments which use magnets in their design.
6. Work surfaces should be level and rigid.

#### *E. Safety*

As is the case with any material handling equipment, certain safety precautions should be observed during operation:


1. Never load the platform beyond its rated capacity. Refer to the rating on the serial number plate of the platform.
2. Ensure that any structure which supports the platform is capable of withstanding the weight of the platform plus its rated capacity load.
3. Do not load the platform if there is any evidence of damage to the platform or supporting structure.

#### *F. Installation*

1. Using the AC adapter, insert the power cord into the receptacle located on the rear left side. Firmly push in the plug.
2. Allow the instrument to warm up for 30 minutes prior to use.

## Section 3: Programming

### A. Function Keys

 = Select

 = [AutoTare] = Enter

### B. Program

Press and hold any key while powering ON. The display will show CAL.

Press the [ON/ F] key goes to program sequence.

Press the [ON/ F] key for parameter selecting and

Press the [AutoTare] key to enter choice and advance to the next step.

The program sequence is as follows:

	<b>Displays:</b>	<b>Definition</b>
A. <b>Zero Range</b>	Or . 0	100% of Capacity
	Or . 1	2% of Capacity
B. <b>Auto power off</b>	AoFF 0	None
	AoFF 1	5 minutes
	AoFF 2	10 minutes
	AoFF 3	20 minutes
	AoFF 4	30 minutes
C. <b>Backlit</b>	bL 0	None
	bL 1	Active
	bL 2	Auto lighting while loading
D. <b>Counting mode</b>	SAMP 0	Counting mode Disable
	SAMP 1	Counting mode Enable

Instrument will count down 9..8..7..6..5..4..3..2..1..0 and return to the weigh mode.



## Section 4: Calibration

### A. Function Keys




= [AutoTare] = Enter



= Select

### B. Calibration Procedure

1. Remove the jumper JP3 to calibrate the scale.

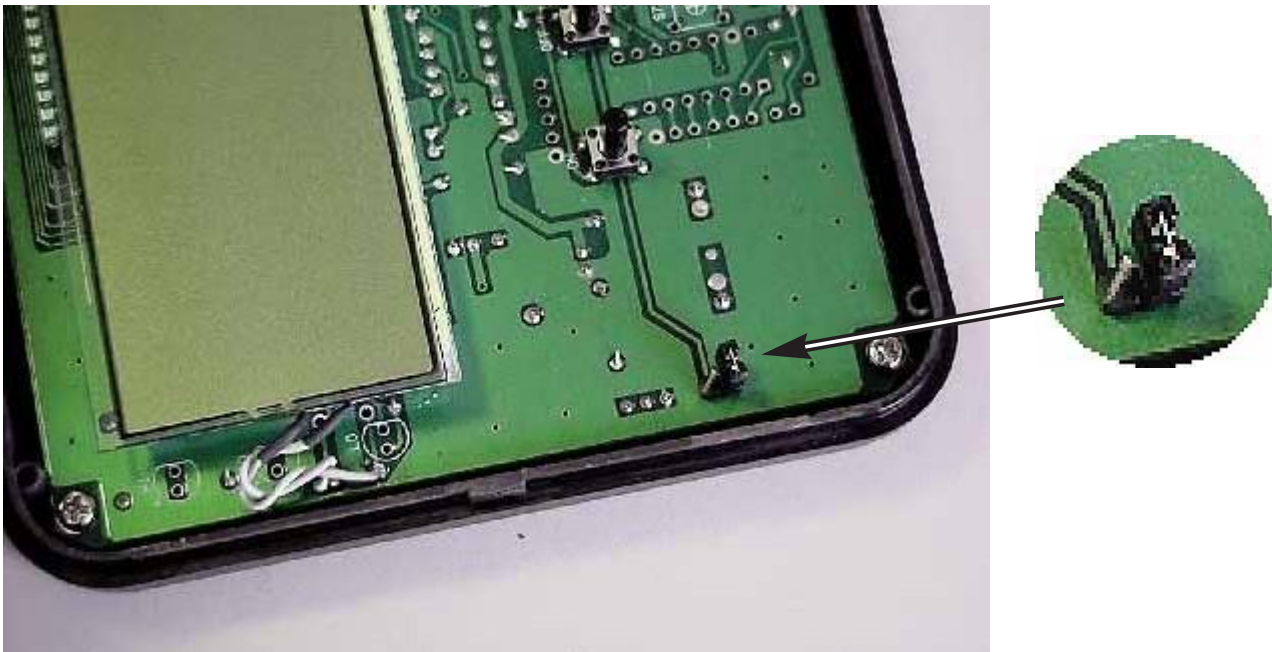

2. Press and hold any key while powering ON.  
The system goes to Calibration mode.

**CAL**

3. Press the [AutoTare] key to select the  
AUTO ZERO mode  
Press the [ON/ F] key to select the desired choice.

**Displays:**

**Definition**

AO 0	None
AO 1AZT	0.6d
AO 2AZT	1.0d
AO 3AZT	2.0d

4. Press the [AutoTare] key to step to the  
WEIGHING UNITS mode  
Press the [ON/ F] key to select weighing units in lb or kg.

Unit.LB	lbs mode
Unit.kG	kg mode

5. Press the [AutoTare] key to step to the CAPACITY mode.  
Press the [ON/ F] key to select the appropriate Capacity.


**C XXXXX**

6. Press the [AutoTare] key to go to the division size mode.  $d=0.01$   
 Press the [ON/F] key to select the appropriate division size
- $d=0.02$
  - $d=0.05$
  - $d=0.1$
  - $d=0.2$
  - $d=0.5$

**Note:** Step 6 is available only in scales with serial number S05159000150 and above.

7. Press the [AutoTare] key to go to SPAN mode. 12222  
 (Offset value to be displayed around 5000 ~ 50000 )
8. Press the [ZERO] key to set the display to zero. 0
9. Put on the calibrating weight in lb or kg. 122225  
 (Span value to be 100000 ~ 250000 at full capacity )
10. Press the [AutoTare] key and the indicator will cycle 600  
 through a list of permissible weights. When the weight  
 on the scale is displayed, press the [AutoTare] key.
11. The calibration is now complete, install the JP3 jumper to secure the calibration.

## Section 5: Operation

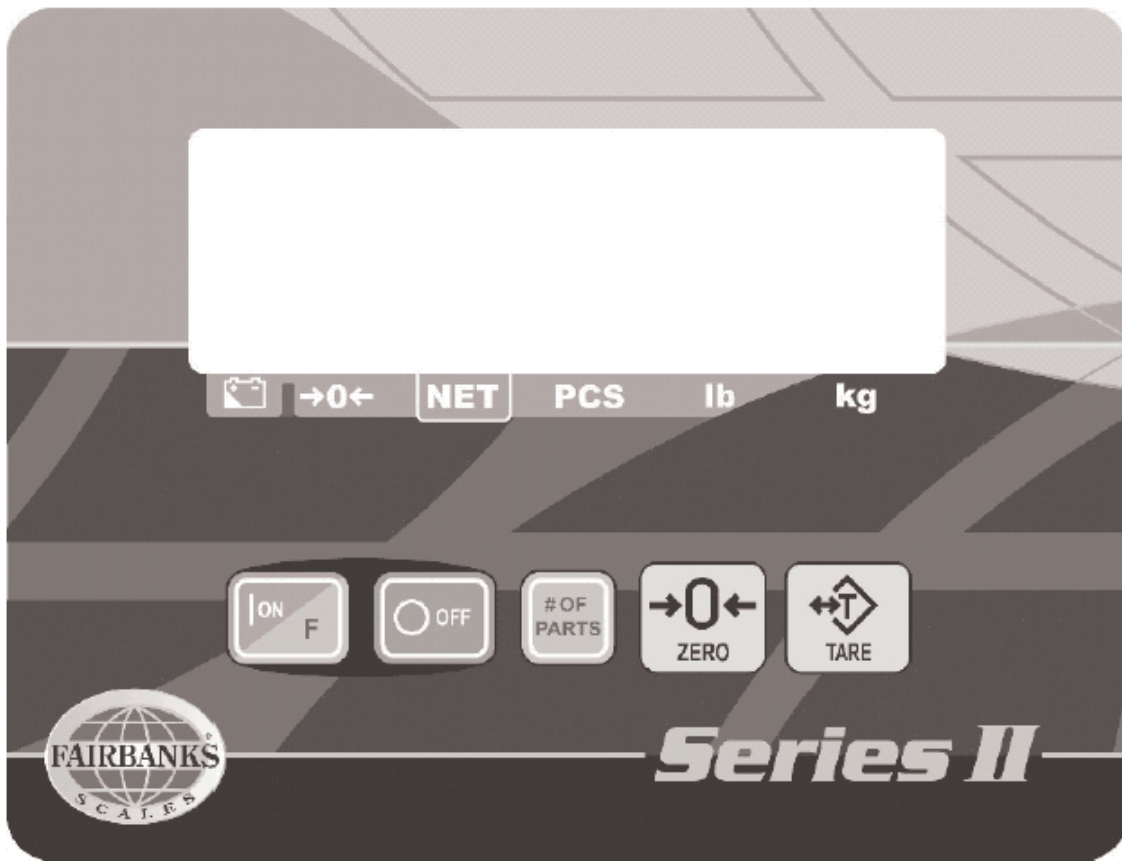

### A. Function keys



- a. Turns instrument On.
- b. Function key.  
Used for toggle switch between display weight, check-weigh or total accumulation.



Turns instrument Off.



Used for parts counting.



Captures a new center of zero.




Auto Tare. Captures the gross weight on scale as a tare weight.

**Charge** An LED on the back of the housing next to the AC Adapter connection illuminates when connected to AC power. This also indicates the battery is recharging.



## *B. Instrument Weighing Operation*


### **1. Taring**

All models have taring capabilities up to their total weight capacity. To weigh a sample in its container with the display showing the weight of the sample use the following tare procedure.

- a. Place sample container on pan and then press the  key.
- b. Now place sample in its container.
- c. When the balance is stable, the display shows the weight of the sample.

### **2. Counting Function**

- a. Counting feature must be enabled; it comes from the factory disabled.
- b. Count the desired number of sample pieces (10, 20, 50, 100 or 200 total pieces )
- c. Press  key to display total count numbers of 10, 20, 50 or 100, or 200.  
This number will cycle.  
Press  key again to select sample size.  
Once it is displayed, the arrow at the bottom of the display will point to **PCS**.
- d. You are now ready to perform parts counting of those specific pieces.





Press  key for the total weight.

### **3. Weighing Units Selection**

Press and hold  key then press  key for lb or kg selection.

## Section 6: Service and Maintenance

### A. Error message(s)
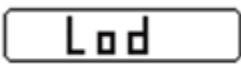
<i>Symptom</i>	<i>Cause</i>	<i>Solution</i>
	Over load : * Weighing range exceed	Unload scale or reduce load on scale.
	Under load : * Weighing pan not in place  * Weighing range below zero	Ensure the weighing pan is correctly installed and surrounding parts are not touching  Set scale to zero
	The instrument cannot read the A/D signal.  The load cell cable is not connected properly or the load cell is damaged.:	Check the load cell cable connection or replace the load cell.
	Low Battery Condition * Below 5.5Vdc	Plug AC/DC adapter to scale to allow the battery to recharge.

## Section 7: Parts

### A. Replacement Parts List

<u>Item</u>	<u>P/N</u>	<u>Description</u>
1	24157	AC/DC Adapter 120VAC - 9Vdc @ 500 mA
2	27391	Battery
3	26205	Aluminum Load Cell, 50kg Cap., 2mV/V ( <b>Series II P/N 25825</b> )
4	26206	Aluminum Load Cell, 75kg Cap., 2mV/V ( <b>Series II P/N 25826</b> )
5	26207	Aluminum Load Cell, 100kg Cap., 2mV/V ( <b>Series II P/N 25827 &amp; 25828</b> )
6	26208	Aluminum Load Cell, 200kg Cap., 2mV/V ( <b>Series II P/N 25829 &amp; 25830</b> )
7	26209	Aluminum Load Cell, 150kg Cap., 2mV/V ( <b>Series II P/N 25831 &amp; 25832</b> )
8	26210	Aluminum Load Cell, 200kg Cap., 2mV/V ( <b>Series II P/N 25833</b> )
9	26211	Aluminum Load Cell, 250kg Cap., 2mV/V ( <b>Series II P/N 25834</b> )
10	26212	Aluminum Load Cell, 300kg Cap., 2mV/V ( <b>Series II P/N 25835 &amp; 25836</b> )
11	26213	Rubber Foot for Series II/III, 3/8" x 1-1/2" Threaded Stem (Sm. Plat Size)
12	26214	Plastic foot for Series II/III, 1/2" x 2-1/2" Threaded Stem (Lg. Plat Size)
13	28199	Series II PCB
14	28201	Series II Overlay

*There are no other serviceable parts available other than the items listed above.*